



MIROTONE

Leading the way in coating systems since 1938

MIROSOL 1260

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

Hazard Alert Code: HIGH

CHEMWATCH 5024-08
Version No:7
CD 2011/2 Page 1 of 9

Section 1 - CHEMICAL PRODUCT AND COMPANY IDENTIFICATION

PRODUCT NAME

MIROSOL 1260 Retarder

STATEMENT OF HAZARDOUS NATURE

Considered a Hazardous Substance according to the criteria of the New Zealand Hazardous Substances New Organisms legislation.

PROPER SHIPPING NAME

PAINT RELATED MATERIAL

PRODUCT USE

■ The use of a quantity of material in an unventilated or confined space may result in increased exposure and an irritating atmosphere developing. Before starting consider control of exposure by mechanical ventilation.

Used according to manufacturer's directions.

Reducer for coatings.

SUPPLIER

Company: Mirotone (NZ) Limited

Address:

32 Cryers Road

East Tamaki, Manukau 2163

P.O. Box 58149, Botany, Manukau 2013,

Telephone: 0800 FINISH (0800 34 64 74)

Telephone: 09 272 2562


Emergency Tel: **111 In Case of Fire or Spill**

Emergency Tel: **0800 POISON (0800 764 766)**

Fax: 0800 34 64 34

Section 2 - HAZARDS IDENTIFICATION

CHEMWATCH HAZARD RATINGS

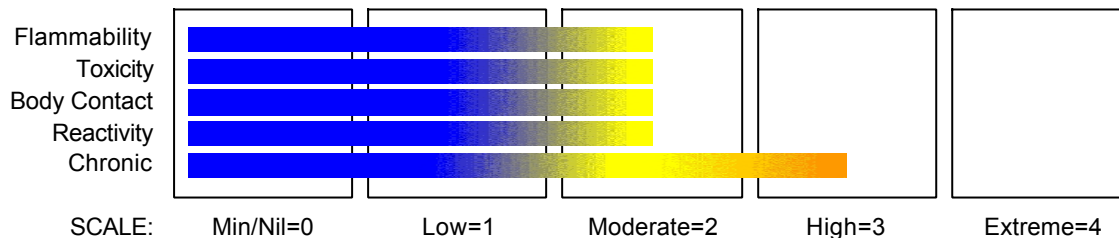

GHS Classification

Eye Irritation Category 2A

Flammable Liquid Category 3

Reproductive Toxicity Category 1B

Skin Corrosion/Irritation Category 2

STOT - SE Category 3

continued...

MIROSOL 1260

Hazard Alert Code: HIGH

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08

Version No:7

CD 2011/2 Page 2 of 9

Section 2 - HAZARDS IDENTIFICATION



EMERGENCY OVERVIEW

HAZARD

DANGER

Determined by Chemwatch using GHS/HSNO criteria

3.1C	Flammable liquid and vapour.
6.4A	Causes serious eye irritation.
6.8A	May damage fertility or the unborn child.
6.9	May cause respiratory irritation.
6.3A	Causes skin irritation.

PRECAUTIONARY STATEMENTS

Prevention

P201	Obtain special instructions before use.
P202	Do not handle until all safety precautions have been read and understood.
P210	Keep away from heat/sparks/open flames/hot surfaces. - No smoking.
P233	Keep container tightly closed.
P240	Ground/bond container and receiving equipment.
P241	Use explosion- proof electrical/ventilating/lighting/ ... /equipment
P242	Use only non- sparking tools.
P243	Take precautionary measures against static discharge.
P261	Avoid breathing dust/fume/gas/mist/vapours/spray.
P264	Wash ... thoroughly after handling.
P271	Use only outdoors or in a well- ventilated area.
P280	Wear protective gloves/protective clothing/eye protection/face protection.
P281	Use personal protective equipment as required.

Response

P303+P361+P353	IF ON SKIN (or hair): Remove/Take off immediately all contaminated clothing. Rinse skin with water/shower.
P304+P340	IF INHALED: Remove to fresh air and keep at rest in a position comfortable for breathing.
P305+P351+P338	IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.
P308+P313	IF exposed or concerned: Get medical advice/ attention.
P312	Call a POISON CENTER or doctor/physician if you feel unwell.
P337+P313	If eye irritation persists: Get medical advice/attention.

Storage

P403+P233	Store in a well- ventilated place. Keep container tightly closed.
P403+P235	Store in a well- ventilated place. Keep cool.
P405	Store locked up.

Disposal

P501	Dispose of contents/container to ...
------	--------------------------------------

Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
Solvent	None	>90

Section 4 - FIRST AID MEASURES

NEW ZEALAND POISONS INFORMATION CENTRE 0800 POISON (0800 764 766)
NZ EMERGENCY SERVICES: 111

continued...

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08
Version No:7
CD 2011/2 Page 3 of 9
Section 4 - FIRST AID MEASURES

SWALLOWED

- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- If spontaneous vomiting appears imminent or occurs, hold patient's head down, lower than their hips to help avoid possible aspiration of vomitus.

EYE

- If this product comes in contact with the eyes:
 - Wash out immediately with fresh running water.
 - Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
 - Seek medical attention without delay; if pain persists or recurs seek medical attention.
 - Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

SKIN

- If skin contact occurs:
 - Immediately remove all contaminated clothing, including footwear.
 - Flush skin and hair with running water (and soap if available).
 - Seek medical attention in event of irritation.

INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.

NOTES TO PHYSICIAN

- Any material aspirated during vomiting may produce lung injury. Therefore emesis should not be induced mechanically or pharmacologically.
Treat symptomatically.

Section 5 - FIRE FIGHTING MEASURES

EXTINGUISHING MEDIA

- Water spray or fog.
- Alcohol stable foam.
- Dry chemical powder.
- Carbon dioxide.

Do not use a water jet to fight fire.

FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
 - May be violently or explosively reactive.
 - Wear breathing apparatus plus protective gloves.
 - Prevent, by any means available, spillage from entering drains or water course.
- When any large container (including road and rail tankers) is involved in a fire, consider evacuation by 500 metres in all directions.

FIRE/EXPLOSION HAZARD

- Liquid and vapour are flammable.
 - Moderate fire hazard when exposed to heat or flame.
 - Vapour forms an explosive mixture with air.
 - Moderate explosion hazard when exposed to heat or flame.
- Combustion products include: carbon monoxide (CO), carbon dioxide (CO₂), other pyrolysis products typical of burning organic material.
- Contains low boiling substance: Closed containers may rupture due to pressure buildup under fire conditions.

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08

Version No:7

CD 2011/2 Page 4 of 9

Section 5 - FIRE FIGHTING MEASURES

FIRE INCOMPATIBILITY

- Avoid contamination with oxidising agents i.e. nitrates, oxidising acids, chlorine bleaches, pool chlorine etc. as ignition may result.

Personal Protective Equipment

Breathing apparatus.
Chemical splash suit.

Section 6 - ACCIDENTAL RELEASE MEASURES

MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.
- Control personal contact by using protective equipment.

MAJOR SPILLS

- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- May be violently or explosively reactive.
- Wear breathing apparatus plus protective gloves.

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

Section 7 - HANDLING AND STORAGE

PROCEDURE FOR HANDLING

- Containers, even those that have been emptied, may contain explosive vapours.
- Do NOT cut, drill, grind, weld or perform similar operations on or near containers.

Contains low boiling substance:

Storage in sealed containers may result in pressure buildup causing violent rupture of containers not rated appropriately.

- Check for bulging containers.

- Vent periodically

- Always release caps or seals slowly to ensure slow dissipation of vapours.

- DO NOT allow clothing wet with material to stay in contact with skin.

The tendency of many ethers to form explosive peroxides is well documented. Ethers lacking non-methyl hydrogen atoms adjacent to the ether link are thought to be relatively safe

- DO NOT concentrate by evaporation, or evaporate extracts to dryness, as residues may contain explosive peroxides with DETONATION potential.

- Any static discharge is also a source of hazard.

- Before any distillation process remove trace peroxides by shaking with excess 5% aqueous ferrous sulfate solution or by percolation through a column of activated alumina.

- Distillation results in uninhibited ether distillate with considerably increased hazard because of risk of peroxide formation on storage.

- Overheating of ethoxylates in air should be avoided. When some ethoxylates are heated vigorously in the presence of air or oxygen, at temperatures exceeding 160 C, they may undergo exothermic oxidative degeneration resulting in self-heating and autoignition.

- Nitrogen blanketing will minimise the potential for ethoxylate oxidation.

- Trace quantities of ethylene oxide may be present in the material. Although these may accumulate in the headspace of storage and transport vessels, concentrations are not expected to exceed levels which might produce a flammability or worker exposure hazard.

The substance accumulates peroxides which may become hazardous only if it evaporates or is distilled or otherwise treated to concentrate the peroxides. The substance may concentrate around the container opening for example.

Purchases of peroxidisable chemicals should be restricted to ensure that the chemical is used completely before it can become peroxidised.

- A responsible person should maintain an inventory of peroxidisable chemicals or annotate the general chemical inventory to indicate which chemicals are subject to peroxidation. An expiration date should be determined. The chemical should either be treated to remove peroxides or disposed of before this date.

- Avoid all personal contact, including inhalation.

- Wear protective clothing when risk of overexposure occurs.

- Use in a well-ventilated area.

MIROSOL 1260

Hazard Alert Code: HIGH

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08

Version No:7

CD 2011/2 Page 5 of 9

Section 7 - HANDLING AND STORAGE

- Prevent concentration in hollows and sumps.

SUITABLE CONTAINER

- Packing as supplied by manufacturer.
- Plastic containers may only be used if approved for flammable liquid.
- Check that containers are clearly labelled and free from leaks.
- For low viscosity materials (i) : Drums and jerry cans must be of the non-removable head type. (ii) : Where a can is to be used as an inner package, the can must have a screwed enclosure.
- For materials with a viscosity of at least 2680 cSt. (23 deg. C)
- For manufactured product having a viscosity of at least 250 cSt. (23 deg. C)
- Manufactured product that requires stirring before use and having a viscosity of at least 20 cSt (25 deg. C).

STORAGE INCOMPATIBILITY

- Avoid reaction with oxidising agents.

STORAGE REQUIREMENTS

- Store in original containers in approved flammable liquid storage area.
- Store away from incompatible materials in a cool, dry, well-ventilated area.
- DO NOT store in pits, depressions, basements or areas where vapours may be trapped.
- No smoking, naked lights, heat or ignition sources.

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

EXPOSURE CONTROLS

PERSONAL PROTECTION



RESPIRATOR

- Type A Filter of sufficient capacity. (AS/NZS 1716 & 1715, EN 143:2000 & 149:2001, ANSI Z88 or national equivalent)

EYE

- Safety glasses with side shields.
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59], [AS/NZS 1336 or national equivalent].

HANDS/FEET

- Wear chemical protective gloves, eg. PVC.
- Wear safety footwear or safety gumboots, eg. Rubber.

Suitability and durability of glove type is dependent on usage. Important factors in the selection of gloves include:

- frequency and duration of contact,
- chemical resistance of glove material,
- glove thickness and
- dexterity.

OTHER

- Overalls.
- PVC Apron.
- PVC protective suit may be required if exposure severe.
- Eyewash unit.

continued...

MIROSOL 1260

Hazard Alert Code: HIGH

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08
Version No:7
CD 2011/2 Page 6 of 9

Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

- Some plastic personal protective equipment (PPE) (e.g. gloves, aprons, overshoes) are not recommended as they may produce static electricity.
- For large scale or continuous use wear tight-weave non-static clothing (no metallic fasteners, cuffs or pockets), non sparking safety footwear.

ENGINEERING CONTROLS

■ Engineering controls are used to remove a hazard or place a barrier between the worker and the hazard. Well-designed engineering controls can be highly effective in protecting workers and will typically be independent of worker interactions to provide this high level of protection.

The basic types of engineering controls are:

Process controls which involve changing the way a job activity or process is done to reduce the risk.

Enclosure and/or isolation of emission source which keeps a selected hazard "physically" away from the worker and ventilation that strategically "adds" and "removes" air in the work environment.

Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

APPEARANCE

Clear colourless flammable liquid with a solvent odour; partially miscible with water (<40%).

PHYSICAL PROPERTIES

Liquid.

State	Liquid	Molecular Weight	Not Applicable
Melting Range (°C)	Not Available	Viscosity	Not Available
Boiling Range (°C)	Not Available	Solubility in water (g/L)	Partly Miscible
Flash Point (°C)	47	pH (1% solution)	Not Applicable
Decomposition Temp (°C)	Not Available	pH (as supplied)	Not Applicable
Autoignition Temp (°C)	Not Available	Vapour Pressure (kPa)	Not Available
Upper Explosive Limit (%)	Not Available	Specific Gravity (water=1)	0.95- 1.00
Lower Explosive Limit (%)	Not Available	Relative Vapour Density (air=1)	>1
Volatile Component (%vol)	100 (VOC = 100%)	Evaporation Rate	Not Available

Section 10 - CHEMICAL STABILITY

CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

For incompatible materials - refer to Section 7 - Handling and Storage.

Section 11 - TOXICOLOGICAL INFORMATION

POTENTIAL HEALTH EFFECTS

ACUTE HEALTH EFFECTS

SWALLOWED

■ Although ingestion is not thought to produce harmful effects (as classified under EC Directives), the material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (e.g liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health).

EYE

■ Limited evidence exists, or practical experience suggests, that the material may cause eye irritation in a substantial number of individuals and/or is expected to produce significant ocular lesions which are present twenty-four hours or more after instillation into the eye(s) of experimental animals.

Repeated or prolonged eye contact may cause inflammation characterised by temporary redness (similar to windburn) of the

continued...

MIROSOL 1260

Hazard Alert Code: HIGH

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08

Version No:7

CD 2011/2 Page 7 of 9

Section 11 - TOXICOLOGICAL INFORMATION

conjunctiva (conjunctivitis); temporary impairment of vision and/or other transient eye damage/ulceration may occur.

SKIN

■ The material is not thought to be a skin irritant (i.e. is unlikely to produce irritant dermatitis as described in EC Directives using animal models).

INHALED

■ Evidence shows, or practical experience predicts, that the material produces irritation of the respiratory system, in a substantial number of individuals, following inhalation.

In contrast to most organs, the lung is able to respond to a chemical insult by first removing or neutralising the irritant and then repairing the damage.

■ Inhalation of vapours may cause drowsiness and dizziness.

This may be accompanied by narcosis, reduced alertness, loss of reflexes, lack of coordination and vertigo.

■ Inhalation hazard is increased at higher temperatures.

■ Acute effects from inhalation of high concentrations of vapour are pulmonary irritation, including coughing, with nausea; central nervous system depression - characterised by headache and dizziness, increased reaction time, fatigue and loss of co-ordination.

■ Inhalation of aerosols (mists, fumes), generated by the material during the course of normal handling, may be damaging to the health of the individual.

CHRONIC HEALTH EFFECTS

■ Long-term exposure to respiratory irritants may result in disease of the airways involving difficult breathing and related systemic problems.

There is sufficient evidence to provide a strong presumption that human exposure to the material may result in developmental toxicity, generally on the basis of:

- clear results in appropriate animal studies where effects have been observed in the absence of marked maternal toxicity, or at around the same dose levels as other toxic effects but which are not secondary non-specific consequences of the other toxic effects.

Limited evidence suggests that repeated or long-term occupational exposure may produce cumulative health effects involving organs or biochemical systems.

Studies with some glycol ethers (principally the monoethylene glycols) and their esters indicate reproductive changes, testicular atrophy, infertility and kidney function changes. The metabolic acetic acid derivatives of glycol ethers (alkoxyacetic acids), not the ether itself, have been found to be the proximal reproductive toxin in animals.

TOXICITY AND IRRITATION

■ Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound.

for propylene glycol ethers (PGEs):

Typical propylene glycol ethers include propylene glycol n-butyl ether (PnB); dipropylene glycol n-butyl ether (DPnB); dipropylene glycol methyl ether acetate (DPMA); tripropylene glycol methyl ether (TPM).

Testing of a wide variety of propylene glycol ethers Testing of a wide variety of propylene glycol ethers has shown that propylene glycol-based ethers are less toxic than some ethers of the ethylene series.

A BASF report (in ECETOC) showed that inhalation exposure to 545 ppm PGMEA (beta isomer) was associated with a teratogenic response in rabbits; but exposure to 145 ppm and 36 ppm had no adverse effects.

The beta isomer of PGMEA comprises only 10% of the commercial material, the remaining 90% is alpha isomer.

Section 12 - ECOLOGICAL INFORMATION

This material and its container must be disposed of as hazardous waste.

Ecotoxicity

Ingredient	Persistence: Water/Soil	Persistence: Air	Bioaccumulation	Mobility
MIROSOL 1260	No Data Available	No Data Available		
Solvent	No Data Available	No Data Available		

continued...

MIROSOL 1260

Hazard Alert Code: HIGH

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08
Version No:7
CD 2011/2 Page 8 of 9

Section 13 - DISPOSAL CONSIDERATIONS

- Containers may still present a chemical hazard/ danger when empty.
 - Return to supplier for reuse/ recycling if possible.
- Otherwise:
- If container can not be cleaned sufficiently well to ensure that residuals do not remain or if the container cannot be used to store the same product, then puncture containers, to prevent re-use, and bury at an authorised landfill.
 - Where possible retain label warnings and MSDS and observe all notices pertaining to the product.
- Legislation addressing waste disposal requirements may differ by country, state and/ or territory. Each user must refer to laws operating in their area.
- A Hierarchy of Controls seems to be common - the user should investigate:
- Reduction.
 - DO NOT allow wash water from cleaning or process equipment to enter drains.
 - It may be necessary to collect all wash water for treatment before disposal.
 - In all cases disposal to sewer may be subject to local laws and regulations and these should be considered first.
 - Where in doubt contact the responsible authority.
 - Recycle wherever possible.
 - Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
 - Dispose of by: burial in a land-fill specifically licenced to accept chemical and / or pharmaceutical wastes or Incineration in a licenced apparatus (after admixture with suitable combustible material).
 - Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.
- Insure that the disposal of material is carried out in accordance with Hazardous Substances (Disposal) Regulations 2001.*

Section 14 - TRANSPORTATION INFORMATION



Labels Required: FLAMMABLE LIQUID

HAZCHEM:

•3Y

Land Transport UNDG:

Class or division:	3	Subsidiary risk:	None
UN No.:	1263	UN packing group:	III

Shipping Name: PAINT RELATED MATERIAL (including paint thinning or reducing compound)

Air Transport IATA:

UN/ID Number:	1263	Packing Group:	III
Special provisions:	A3		
Cargo Only			
Packing Instructions:	366	Maximum Qty/Pack:	220 L
Passenger and Cargo		Passenger and Cargo	
Packing Instructions:	Y344	Maximum Qty/Pack:	60 L
Passenger and Cargo Limited Quantity		Passenger and Cargo Limited Quantity	
Packing Instructions:	355	Maximum Qty/Pack:	10 L

Shipping name: PAINT RELATED MATERIAL

Maritime Transport IMDG:

IMDG Class:	3	IMDG Subrisk:	None
UN Number:	1263	Packing Group:	III
EMS Number:	F-E,S-E	Special provisions:	163 223 955
Limited Quantities:	5 L		

Shipping Name: PAINT (including paint, lacquer, enamel, stain, shellac solutions, varnish, polish, liquid filler and liquid lacquer bas

continued...

MIROSOL 1260

Hazard Alert Code: HIGH

MIROSOL 1260
Issue Date: 14-Jul-2011
XC9477SC

CHEMWATCH 5024-08
Version No:7
CD 2011/2 Page 9 of 9

Section 15 - REGULATORY INFORMATION

ERMA Approval number

This substance is to be managed in accordance with the classification and controls specified in the Hazardous Substances Transfer Notice, 2004, (see table below). This substance may alternatively be managed under the conditions imposed by an applicable Group Standard.

HSR No.	HSR Name
HSR002495	Additives, Process Chemicals and Raw Materials (Flammable) Group Standard 2006
HSR002528	Cleaning Products (Flammable) Group Standard 2006
HSR002548	Corrosion Inhibitors (Flammable) Group Standard 2006
HSR002556	Dental Products (Flammable) Group Standard 2006
HSR002563	Embalming Products (Flammable) Group Standard 2006
HSR002583	Fuel Additives (Flammable) Group Standard 2006
HSR002599	Leather and Textile Products (Flammable) Group Standard 2006
HSR002611	Metal Industry Products (Flammable) Group Standard 2006
HSR002621	N.O.S. (Flammable) Group Standard 2006
HSR002637	Photographic Chemicals (Flammable) Group Standard 2006
HSR002641	Polymers (Flammable) Group Standard 2006
HSR002650	Solvents (Flammable) Group Standard 2006
HSR002662	Surface Coatings and Colourants (Flammable) Group Standard 2006
HSR002682	Water Treatment Chemicals (Flammable [3.1C]) Group Standard 2006
HSR100425	Pharmaceutical Active Ingredients Group Standard 2010
HSR002603	Lubricants (Flammable) Group Standard 2006

REGULATIONS

Regulations for ingredients

No data for MIROSOL 1260 (CW: 5024-08)

No data for Solvent (CW: 4594-12)

Specific advice on controls required for materials used in New Zealand can be found at
<http://www.ermanz.govt.nz/search/registers.html>

Section 16 - OTHER INFORMATION

NEW ZEALAND POISONS INFORMATION CENTRE

0800 POISON (0800 764 766)

NZ EMERGENCY SERVICES: 111

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

www.chemwatch.net/references.

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings.

This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.

Issue Date: 14-Jul-2011